

Схемы конструктивных исполнений переключателей ПМО.

Типоисполнения, углы поворота рукояток и схемы сборки




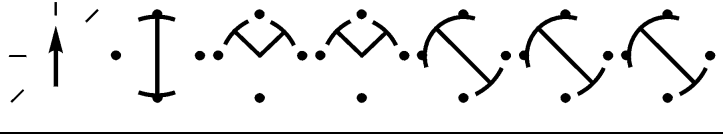

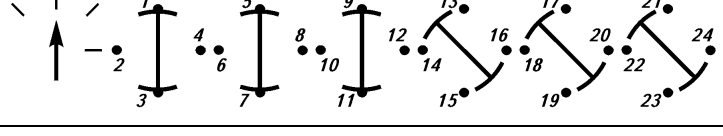

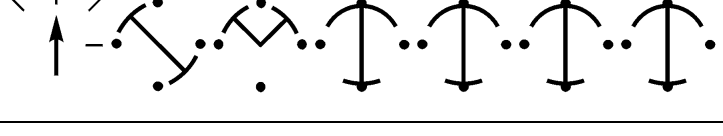

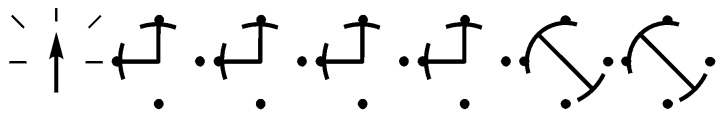
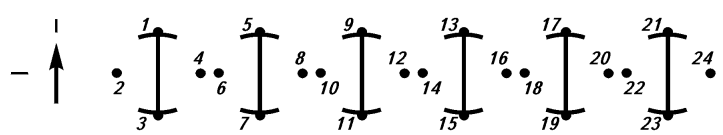
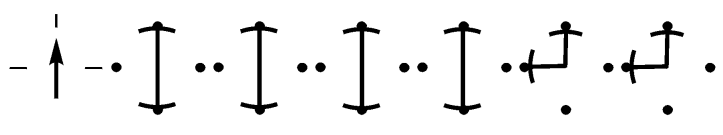
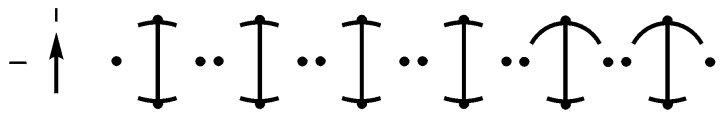
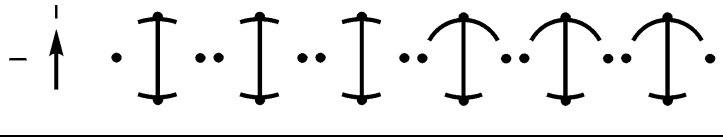
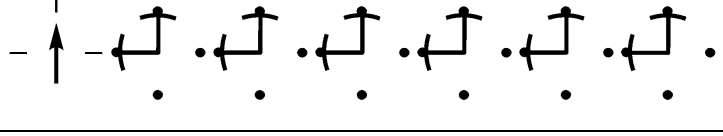
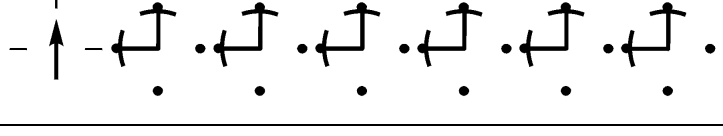

Типоисполнение	Углы поворота рукояток	Начальное положение рукоятки и подвижных контактов
Переключатели ПМОФ45		
ПМОФ45-112222/1 ¹⁾ . Д1. УЗ ²⁾	45–0–45°	
ПМОФ45-111225/... Д2...	45–0–45°	
ПМОФ45-112266/... Д3...	45–0–45–90°	
ПМОФ45-112244/... Д4...	0–45–90°	
ПМОФ45-112556/... Д5...	90–45–0°	
ПМОФ45-111777/... Д6...	45–0°	
ПМОФ45-112277/... Д7...	45–0–45°	
ПМОФ45-111888/... Д8...	90–45–0–45°	
ПМОФ45-222222/... Д9...	45–0–45°	
ПМОФ45-222444/... Д10...	180–135–90–45–0°	
ПМОФ45-223344/... Д11...	0–45–90–135–180–225°	

ПМОФ45-222555/... Д12...	90-45-0-45°	
ПМОФ45-224466/... Д13...	90-45-0-45-90°	
ПМОФ45-777777/1 ¹⁾ . Д51. У3 ²⁾	45-0-45°	
ПМОФ45-225566/... Д14...	45-0-45°	
ПМОФ45-222777/... Д15...	45-0-45°	
ПМОФ45-222888/... Д16...	45-0-45°	
ПМОФ45-333333/... Д17...	45-0-45°	
ПМОФ45-333333/... Д18...	Без стопора	
ПМОФ45-333344/... Д19...	225-180-135-90-45-0-45°	
ПМОФ45-333344/... Д20...	135-90-45-0-45-90-135°	
ПМОФ45-333444/... Д21...	135-90-45-0-45-90-135°	
ПМОФ45-333444/... Д22...	Без стопора	

ПМОФ45-334444/... Д23...	0-45-90°	
ПМОФ45-344445/... Д24...	0-45-90°	
ПМОФ45-333456/... Д25...	45-0-45°	
ПМОФ45-334466/... Д26...	90-45-0-45°	
ПМОФ45-334466/... Д27...	225-180-135-90-45-0-45°	
ПМОФ45-334466/... Д28...	Без стопора	
ПМОФ45-444777/1 ¹⁾ . Д29. У3 ²⁾	0-45-90-135-180°	
ПМОФ45-555556/... Д30...	90-45-0-45°	
ПМОФ45-555666/... Д31...	90-45-0-45-90°	
ПМОФ45-556677/... Д32...	90-45-0-45°	
ПМОФ45-558888/... Д33...	0-45-90°	
ПМОФ45-588888/... Д34...	0-45-90°	













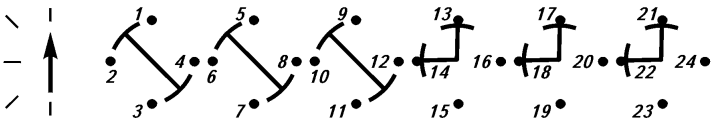





ПМОФ45-666677/... Д35...	90-45-0°	
ПМОФ45-777777/... Д36...	45-0°	
ПМОФ45-778888/... Д37...	90-45-0-45°	
ПМОФ45-888888/... Д38...	45-0-45°	
ПМОФ45-888888/... Д39...	90-45-0-45°	
ПМОФ45-225666/... Д40...	45-0-45°	
ПМОФ45-223355/... Д41...	45-0-45°	
ПМОФ45-233317/... Д83...	45-0-45-90°	
ПМОФ45-555577/... Д84...	0-45-90°	
ПМОФ45-122777/... Д85...	45-0-45-90°	
Переключатели ПМОВФ		
ПМОВФ-111333/1 ¹⁾ . Д70. УЗ ²⁾	 135-90-0-45°	
ПМОВФ-113355/... Д71...	 35-90-0-45°	

ПМОВФ-333556/... Д72...		
ПМОВФ-335566/... Д73...		
ПМОВФ-334466/... Д74...		
ПМОВФ-222888/... Д75...		
ПМОВФ-333333/... Д76...		
ПМОВФ-333777/... Д77...		
ПМОВФ-888888/... Д78...		
ПМОВФ-333456/... Д79...		
ПМОВФ-111339 ₁ /... Д116...		
ПМОВФ-1136 ₃ 6 ₃ 6 ₃ /... Д117...		
ПМОВФ-11366 ₃ 10 ₂ /... Д118...		
ПМОВФ-1136 ₃ 6 ₃ 10 ₂ /... Д119...		

ПМОВФ-13366 ₃ 10 ₂ /... Д120...		
ПМОВФ-13310 ₂ 10 ₂ 10 ₂ /... Д121...		
ПМОФ45-111222/1 ¹⁾ . Д86. У3 ²⁾		
ПМОФ45-237777/... Д87...		
ПМОФ45-444488/... Д134...		
Переключатели ПМОФ90		
ПМОФ90-111111/... Д42...	90-0°	
ПМОФ90-111144/... Д43...	90-0-90°	
ПМОФ90-111177/... Д44...	90-0°	
ПМОФ90-111777/... Д45...	90-0°	
ПМОФ90-444444/... Д46...	90-0-90°	
ПМОФ90-444444/... Д47...	Без стопора	
ПМОФ90-444888/... Д48...	90-0-90°	

ПМОФ90-444888/... Д49...	Без стопора	
ПМОФ90-777777/... Д50...	90-0°	
ПМОФ90-888888/... Д132...	90-0°	
Переключатели ПМОВ		
ПМОВ-225566/... Д135...		
ПМОВ-111111/л. Д53. УЗ		
ПМОВ-111222/... Д54...		
ПМОВ-112222/... Д55...		
ПМОВ-112233/... Д56...		
ПМОВ-113333/... Д57...		
ПМОВ-112256/... Д58...		
ПМОВ-111266/... Д59...		
ПМОВ-115566/... Д60...		

ПМОВ-222222/... Д61...		
ПМОВ-222555/... Д62...		
ПМОВ-125566/... Д63...		
ПМОВ-222777/... Д64...		
ПМОВ-777777/... Д65...		
ПМОВ-222266/... Д66...		
ПМОВ-12103103103103/... Д67...		
ПМОВ-11336363/... Д69...		
ПМОВФ-135569 ₁ /I ¹⁾ . Д122. У3 ²⁾		
ПМОВФ-136663 ₆₃ /... Д123...		
ПМОВФ-136663 ₁₀₂ /... Д124...		
ПМОВФ-13663 ₁₀₂ 102/... Д125...		

ПМОВФ-1366 ₃ 9 ₁ 10 ₂ /... Д126...		
ПМОВФ-13686 ₃ 10 ₂ /... Д127...		
ПМОВФ-13589 ₁ 10 ₂ /... Д128...		
ПМОВФ-1686 ₃ 9 ₁ 10 ₂ /... Д129...		
ПМОВФ-13636 ₃ 10 ₂ 10 ₂ /... Д130...		
ПМОВФ-35569 ₁ 10 ₂ /... Д131...		
Переключатели ПМОФ ₃ 45		
ПМОФ ₃ 45-222444/... Д101...	180-135-90-45-0°	
ПМОФ ₃ 45-555577/... Д102...	0-45-90°	
ПМОФ ₃ 45-666677/... Д103...	90-45-0°	
ПМОФ ₃ 45-667777/... Д104...	90-45-0°	
ПМОФ ₃ 45-222222/... Д105...	45-0-45°	
ПМОФ ₃ 45-222277/... Д106...	45-0-45°	

ПМОФ ₃ 45-227777/... Д133...	45-0°	
Переключатели ПМОФ ₃ 90		
ПМОФ ₃ 90-111111/1 ¹⁾ . Д111. УЗ ²⁾	90-0°	
ПМОФ ₃ 90-111111/... Д112...	0-90°	

¹⁾ I или II для каждого типоразмера.

²⁾ УЗ или ТЗ для каждого типоразмера.